

Python - AGRD


Operating & Maintenance

Important

Operators – It is required for you to perform these tasks either before or after normal business operating hours when all cooking and prep utensils have been properly cleaned and put away. Employees must ensure that all food products have been removed from the area so as to guard against contamination. Finally, all employees must wash their hands after performing these tasks.

Step 1

Empty the strainer basket **daily** & wipe out under lid.

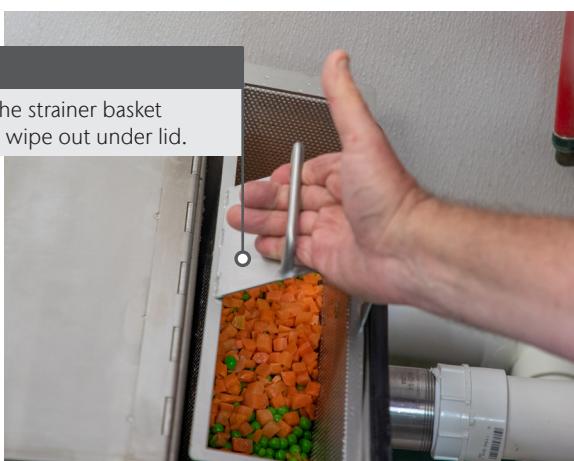

Step 2

Empty oil cassette **daily or as required**.



Step 3

Open flush valve **daily** for 10 seconds with **water flowing** through unit **do not allow unit to empty** as heating element may become damaged.



Step 4

Use the bottlebrush weekly, or **as required** to clean oil outlet assembly- both vertical and horizontal areas.



Oil separating but not being discharged

The oil outlet non-return valve may be stuck due to semi-solidified or sticky oils. The oil outlet assembly should be cleaned with the bottlebrush provided.

In some cases, the blockages may be due to animal fats solidifying in the oil outlet system because they have cooled down— Check that the heater is plugged in. If it is, check the temperature in the inlet chamber and adjust thermostat setting if a higher temperature is required for animal fats.

Oil being discharged with the wastewater even though the unit is discharging oil as normal

This is usually an indication that the unit is being overloaded and the waste is not resident in the unit for a long enough period to allow full separation to take place or the silt release valve has not been operated and there is a silt build up in the unit thereby reducing residence time within the Python™. Operate the silt release valve as described above.

Sinks leading to the Python™ are draining slowly

This is usually an indication that the strainer basket has not been emptied. Please remove, clean and replace the strainer basket.

Wastewater effluent is overflowing into the center section and/or spilling out of the Python™

This is usually an indication that the strainer basket has not been emptied. Please remove, clean and replace the strainer basket.

ACO New Zealand

35 Te Tiki Road
Mangere, Auckland 2022
New Zealand
Tel: +64 (0)9 815 9500
Toll-Free: 0800 448 080

www.askaco.nz/python
info@aconz.co.nz

Print #BD706

Python™
Automatic Grease Removal Device



ACO. we care for water